




3001 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	X	X	-
7 – 8	X	-	X
9 – 10	-	X	-
11 - 12	X	-	-
Маркировка	3	1	2

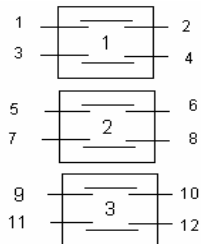


3002 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X
3 – 4	X	-	-
5 – 6	-	X	X
7 - 8	X	-	-
9 – 10	-	X	X
11 - 12	-	-	X
Маркировка	3	1	2

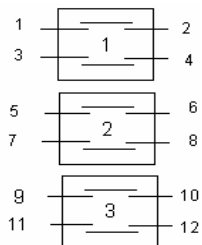


3003 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 – 6	X	-	-	-	X
7 - 8	X	-	-	-	X
9 – 10	-	-	-	X	X
11 - 12	X	X	-	-	-
Маркировка	3	4	0	1	2

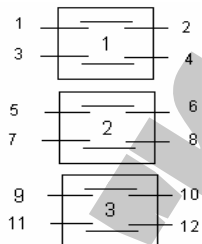


3004 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-	-
3 - 4	X	X	-	-
5 – 6	-	-	-	X
7 - 8	-	-	X	X
9 – 10	-	-	X	-
11 – 12	-	-	X	-
Маркировка	3	4	1	2

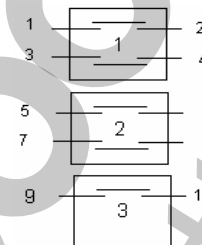


3005 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	-	-	X	-
5 – 6	X	-	-	-	-
7 – 8	-	-	-	-	X
9 - 10	-	X	-	X	-
Маркировка	3	4	0	1	2

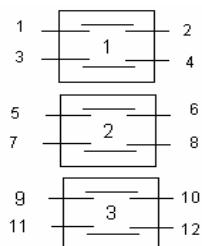


3006 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 - 10	-	-	X	X
11 - 12	-	X	X	-
Маркировка	0	3	1	2

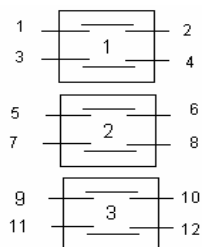


3007 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	X	X	X	X
3 - 4	-	X	X	X	X	X
5 - 6	X	X	X	-	X	X
7 - 8	X	X	-	X	X	X
9 - 10	X	X	X	X	X	-
11 - 12	X	X	X	X	-	X
Маркировка	5	6	1	2	3	4

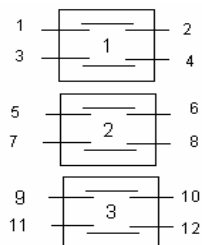


3008 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	X	-	X
5 - 6	X	-	X
7 - 8	X	-	X
9 - 10	X	-	X
11 - 12	-	X	X
Маркировка	3	1	2

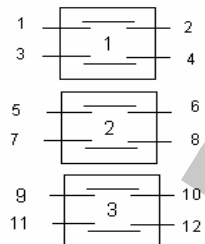


3009 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	-	-	-	X	X	X	X
3 - 4	X	X	X	X	-	-	-	-
5 - 6	-	-	X	X	-	-	X	X
7 - 8	X	X	-	-	X	X	-	-
9 - 10	-	X	-	X	-	X	-	X
11 - 12	X	-	X	-	X	-	X	-
Маркировка	6	7	8	1	2	3	4	5

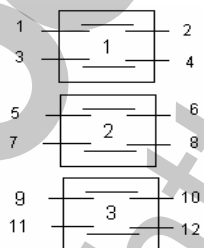


3010 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	-
3 - 4	-	X	-
5 - 6	-	X	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	X	-	X
Маркировка	3	1	2

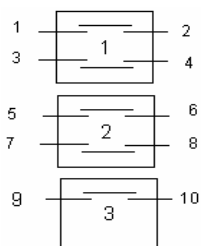


3011 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	-	X	-
5 - 6	-	-	X
7 - 8	-	X	-
9 - 10	-	-	X
Маркировка	0	1	2

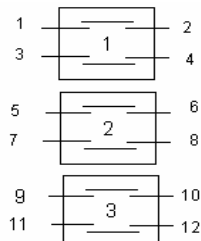


3012 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 ⁰	0 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	X	X	-	-
7 - 8	-	-	-	X
9 - 10	-	-	-	X
11 - 12	X	-	-	-

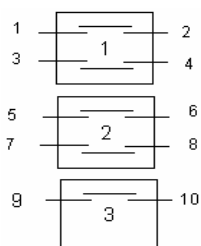


3013 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 - 2	-	-	X	-	X	X
3 - 4	X	X	X	-	-	-
5 - 6	-	-	X	-	X	X
7 - 8	X	X	X	-	-	-
9 - 10	-	X	-	-	-	X
Маркировка	3	4	5	0	1	2

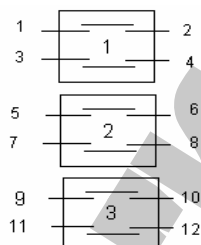


3014 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	-	X
3 - 4	-	X
5 - 6	-	X
7 - 8	-	X
9 - 10	-	X
11 - 12	-	X
Маркировка	0	1

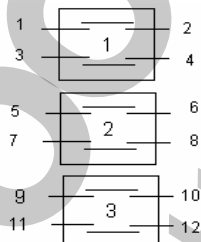


3015 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	-	X	X
3 - 4	X	X	-	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	X	-	-
9 - 10	X	-	-	-	X
11 - 12	-	X	-	X	-
Маркировка	4	5	1	2	3

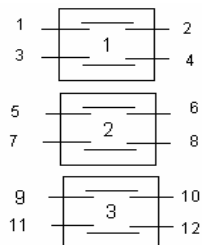


3016 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0° ←	+45°	
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	X	X	-
9 - 10	X	-	-	-
11 - 12	-	-	-	X

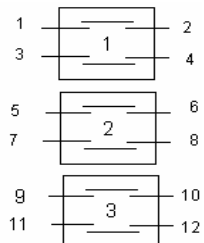


3017 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0° ←	+45°	
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 - 10	-	-	X	X
11 - 12	-	-	X	X

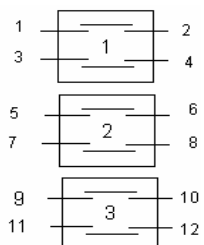


3018 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0° ←	+45°	
1 - 2	-	-	-	X
3 - 4	-	-	-	X
5 - 6	X	-	-	-
7 - 8	X	-	-	-
9 - 10	-	-	X	X
11 - 12	X	X	-	-

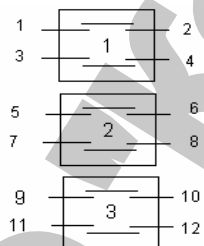


3019 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0° ←	+45°	
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	X	X	-	-
7 - 8	X	X	-	-
9 - 10	X	-	-	-
11 - 12	-	-	-	X

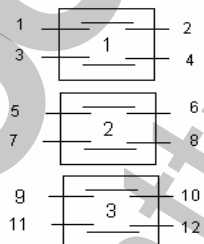


3020 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0° ←	+45°	
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	X	X	-	-
7 - 8	-	X	X	-
9 - 10	-	-	-	X
11 - 12	X	-	-	-

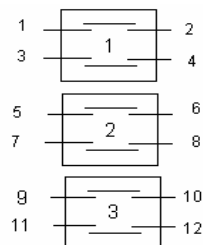


3021 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	+	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	-	-	X
9 - 10	-	X	X	-
11 - 12	-	X	X	-

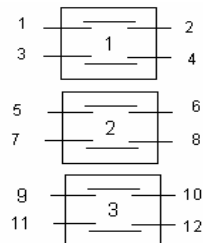


3022 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	+	+45°
1 - 2	-	-	-	X
3 - 4	X	-	-	-
5 - 6	-	-	X	X
7 - 8	-	X	X	-
9 - 10	-	X	X	-
11 - 12	X	X	-	-

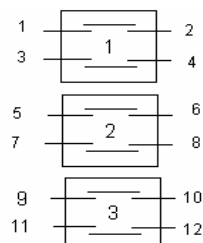


3023 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	X	X
3 - 4	X	X	-
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	X	-	-
Маркировка	3	1	2

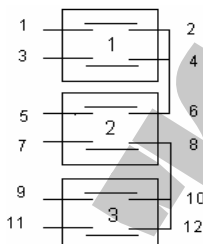


3024 Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90°	0°	+90°
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	-	X	-
7 - 8	-	X	X
9 - 10	X	-	X
11 - 12	X	X	-
Маркировка	3	1	2

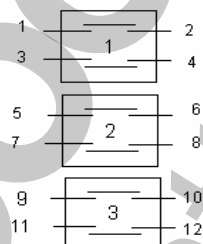


3025 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 - 2	X	X	-	X
3 - 4	-	X	-	-
5 - 6	-	-	-	X
7 - 8	-	-	-	X
9 - 10	X	-	-	-
11 - 12	X	-	-	-
Маркировка	3	4	1	2

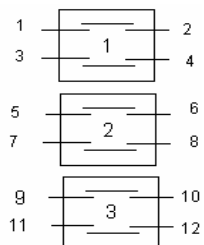


3026 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	-	X	X
7 – 8	X	X	-
9 – 10	-	X	X
11 – 12	X	X	-
Маркировка	3	1	2

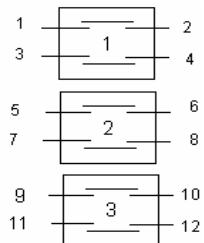


3027 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-	-
3 – 4	-	-	-	-	X
5 – 6	X	-	-	-	-
7 – 8	-	-	-	-	X
9 – 10	-	-	-	X	X
11 – 12	X	X	-	-	-
Маркировка	3	4	0	1	2

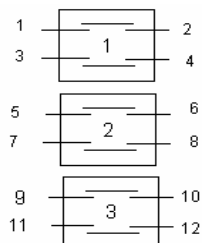


3028 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	X	-
3 – 4	X	X	-	-
5 – 6	-	-	X	X
7 – 8	-	-	X	-
9 – 10	X	-	-	-
11 – 12	-	X	X	-
Маркировка	2	3	0	1

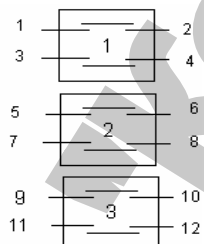


3029 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	X	-
3 – 4	X	X	X	-
5 – 6	X	X	-	-
7 – 8	X	-	X	-
9 – 10	-	-	X	-
11 – 12	-	X	-	-
Маркировка	3	4	1	2

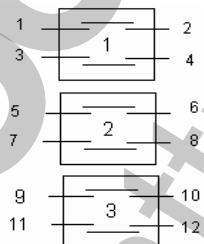


3030 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
Маркировка	2	0	1

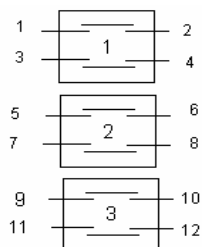


3031 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
Маркировка	2	0	1

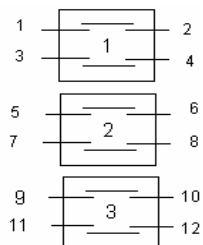


3033 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	X	-	-
11 – 12	X	-	-
Маркировка	2	0	1

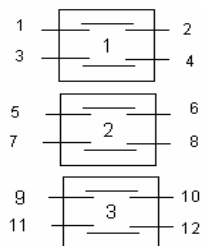


3034 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 – 2	X	-	-	-	-
3 – 4	-	-	-	-	X
5 – 6	-	X	-	-	-
7 – 8	-	-	-	X	X
9 – 10	-	-	-	X	X
11 – 12	-	-	-	X	X
Маркировка	3	4	0	1	2

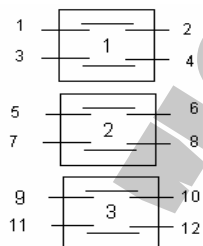


3035 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 – 2	-	-	-	-	X
3 – 4	X	-	-	-	-
5 – 6	-	-	-	X	-
7 – 8	-	X	-	-	-
9 – 10	-	-	X	-	-
11 – 12	-	-	X	-	-
Маркировка	4	5	1	2	3

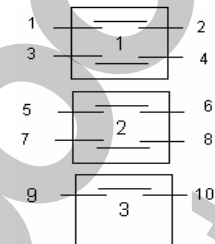


3036 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90°	-45°	0°	+45°	+90°	+135°
1 – 2	X	X	X	-	-	X
3 – 4	X	X	-	-	-	-
5 – 6	-	X	X	X	-	-
7 – 8	-	-	-	-	-	X
9 – 10	-	-	-	-	X	-
Маркировка	5	6	1	2	3	4

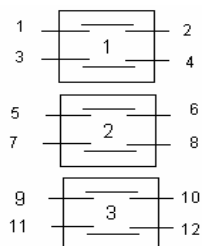


3037 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 - 2	-	-	-	X	-	-	-
3 - 4	X	X	X	-	X	X	X
5 - 6	-	-	-	-	X	X	X
7 - 8	X	X	X	-	-	-	-
9 - 10	X	-	-	-	-	-	X
11 - 12	X	X	-	-	-	X	X
Маркировка	5	6	7	1	2	3	4

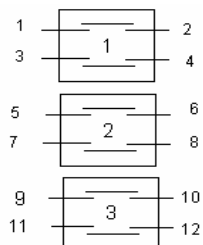


3038 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 - 2	-	-	-	X	-	-	-
3 - 4	-	-	-	X	-	-	-
5 - 6	-	-	-	-	X	X	X
7 - 8	X	X	X	-	-	-	-
9 - 10	-	X	X	-	X	X	-
11 - 12	-	-	X	-	X	-	-
Маркировка	5	6	7	1	2	3	4

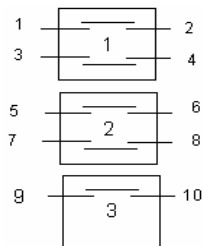


3039 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 - 2	-	X	X	X
3 - 4	-	-	X	X
5 - 6	-	X	X	X
7 - 8	-	-	X	X
9 - 10	-	X	-	X
Маркировка	0	3	1	2

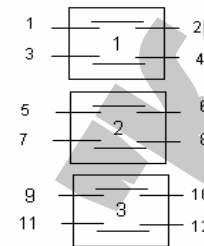


3040 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	-	X
3 - 4	X	-	X
5 - 6	X	-	X
7 - 8	X	-	X
9 - 10	-	X	-
11 - 12	-	X	-
Маркировка	3	1	2

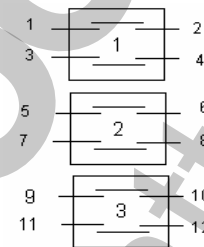


3041 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	-	-	-	X
3 - 4	X	-	-	-	X
5 - 6	-	-	X	-	-
7 - 8	-	X	X	-	-
9 - 10	-	-	X	X	-
11 - 12	X	X	-	X	X
Маркировка	4	5	1	2	3

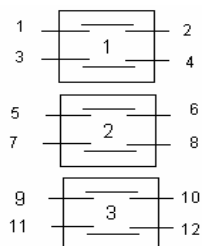


3042 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	X	-	X	-	-
3 - 4	X	-	-	-	-	-	-
5 - 6	-	-	-	-	-	-	X
7 - 8	-	X	X	-	-	-	-
9 - 10	-	X	-	-	-	X	-
11 - 12	-	-	-	-	X	X	-
Маркировка	4	5	6	0	1	2	3

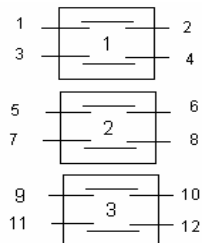


3043 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	X	-	X	-	X
3 - 4	X	X	-	-	-	-
5 - 6	-	X	X	X	-	-
7 - 8	-	-	-	-	-	X
9 - 10	-	-	-	-	X	-
11 - 12	X	X	X	X	-	X
Маркировка	5	6	1	2	3	4

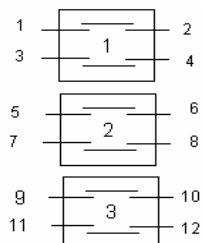


3044 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	-	-
3 - 4	-	-	-	X
5 - 6	X	-	-	-
7 - 8	X	-	-	-
9 - 10	X	-	-	-
11 - 12	-	-	X	-
Маркировка	3	4	1	2

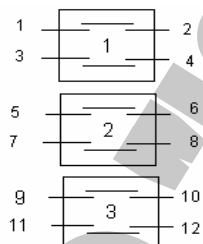


3045 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	X	X
5 - 6	X	-	-
7 - 8	X	X	-
9 - 10	-	X	-
11 - 12	X	X	-
Маркировка	3	1	2

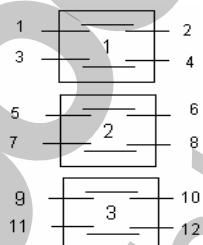


3046 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	X	-	X
5 - 6	-	-	X
7 - 8	X	-	X
9 - 10	-	X	-
11 - 12	X	-	X
Маркировка	3	1	2

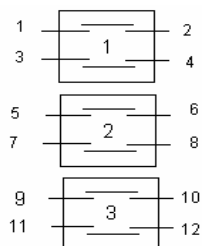


3047 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 - 2	X	X	-	-	-	-	-
3 - 4	X	-	-	-	-	-	-
5 - 6	X	X	X	-	-	-	-
7 - 8	X	X	X	X	-	-	-
9 - 10	X	X	X	X	X	-	-
11 - 12	X	X	X	X	X	X	-
Маркировка	1	2	3	4	5	6	7

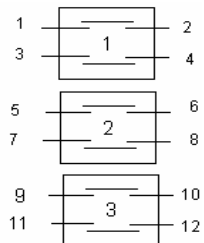


3048 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	X	X
3 - 4	-	X	X
5 - 6	X	X	-
7 - 8	-	X	X
9 - 10	X	X	-
11 - 12	-	X	X
Маркировка	3	1	2

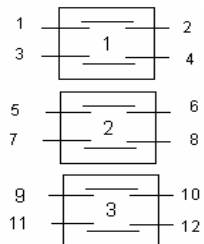


3051 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	X	-	X	X
3 - 4	X	X	-	X	X
5 - 6	X	X	-	X	X
7 - 8	-	X	X	X	-
9 - 10	-	X	X	X	-
11 - 12	-	X	X	X	-
Маркировка	4	5	1	2	3

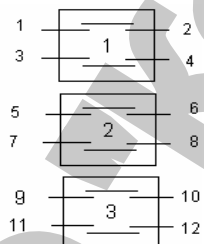


3052 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	X	-	-
Маркировка	2	0	1

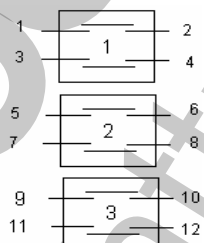


3053 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	-	-
3 - 4	X	-	-
5 - 6	-	-	X
7 - 8	-	X	-
9 - 10	X	-	X
11 - 12	X	-	X
Маркировка	3	1	2

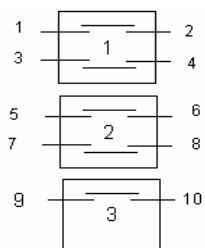


3054 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	-	X	X
3 - 4	X	X	-	-	-
5 - 6	-	-	-	X	X
7 - 8	X	X	-	-	-
9 - 10	X	-	-	-	X
Маркировка	3	4	0	1	2

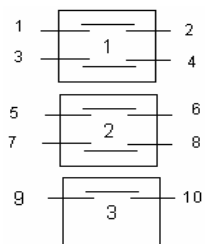


3055 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	-	X	X
5 - 6	X	X	-
7 - 8	X	X	-
9 - 10	-	X	-
Маркировка	3	1	2

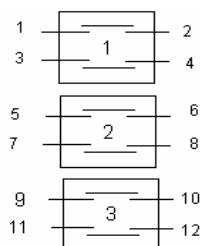


3056 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	-	X	-
11 - 12	X	-	X
Маркировка	3	1	2

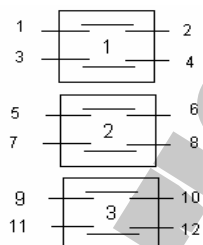


3057 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	X	X
5 - 6	X	-	X
7 - 8	-	X	-
9 - 10	X	X	-
11 - 12	-	-	X
Маркировка	3	1	2

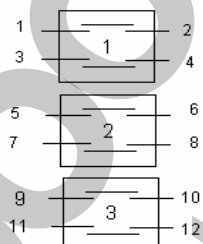


3058 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	-	X	X
5 - 6	X	-	-
7 - 8	X	-	-
9 - 10	-	-	X
11 - 12	-	-	X
Маркировка	3	1	2

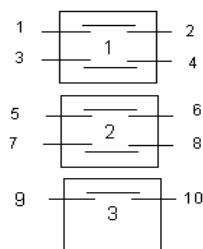


3060 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	-	-	-	X	X
3 - 4	X	-	-	-	-
5 - 6	X	X	-	-	-
7 - 8	-	-	-	-	X
9 - 10	-	-	X	-	-
Маркировка	4	5	1	2	3

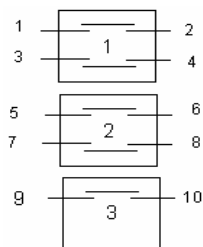


3061 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	X	-	X	X
3 - 4	X	X	-	X	X
5 - 6	X	-	-	-	X
7 - 8	X	X	-	-	-
9 - 10	-	-	-	X	X
Маркировка	3	4	0	1	2

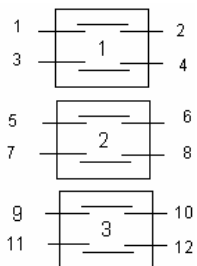


3062 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 - 2	-	X	X	X	X	X	X
3 - 4	-	-	X	X	X	X	X
5 - 6	-	-	-	X	X	X	X
7 - 8	-	-	-	-	X	X	X
9 - 10	-	-	-	-	-	X	X
11 - 12	-	-	-	-	-	-	X
Маркировка	0	5	6	1	2	3	4

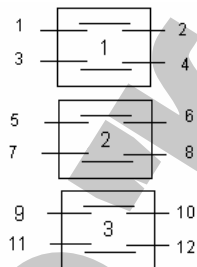


3064 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 - 2	-	X	-	-
3 - 4	-	-	X	X
5 - 6	-	-	-	X
7 - 8	-	X	X	X
9 - 10	-	-	-	X
11 - 12	-	X	X	X
Маркировка	0	3	1	2

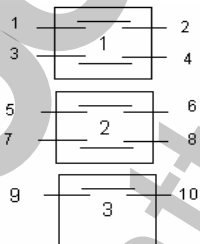


3065 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	-	X
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	-
Маркировка	2	0	1

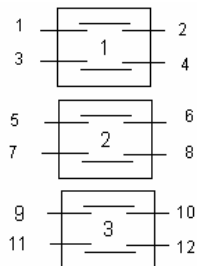


3066 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	X	X	-
5 – 6	-	-	X
7 – 8	X	X	-
9 – 10	-	-	X
11 – 12	X	-	-
Маркировка	3	1	2

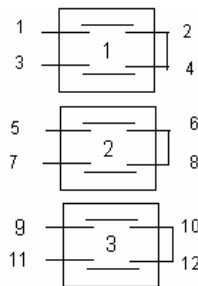


3069 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	-	X
5 – 6	-	X	-
7 – 8	-	-	X
9 – 10	-	X	-
11 – 12	-	-	X
Маркировка	0	1	2

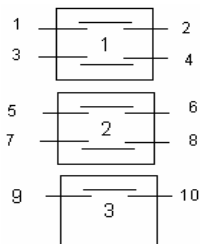


3070 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	X	-
9 – 10	-	-	-	X
Маркировка	0	1	2	3

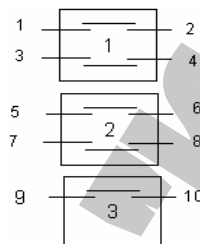


3071 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-
3 – 4	-	-	-	X
5 – 6	-	X	-	-
7 – 8	X	-	-	-
9 – 10	-	X	X	X
Маркировка	4	1	2	3

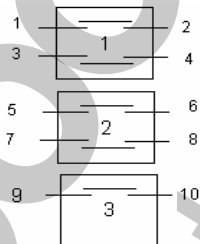


3072 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	X	-	X	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
Маркировка	4	1	2	3

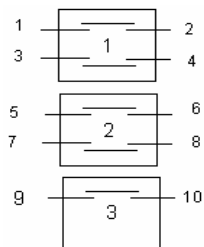


3073 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	-	-	X	-
3 – 4	-	X	-	X
5 – 6	X	-	-	-
7 – 8	-	-	X	-
9 – 10	-	X	-	X
Маркировка	4	1	2	3

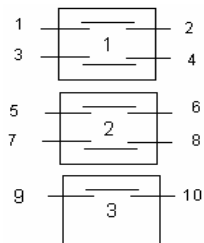


3074 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	-	X	X
3 – 4	-	X	-	-
5 – 6	-	-	-	X
7 – 8	-	X	X	-
9 – 10	-	X	-	-
Маркировка	0	3	1	2

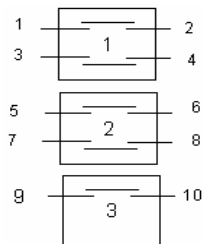


3075 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	-	X	-
3 – 4	X	-	X	-
5 – 6	-	-	-	X
7 – 8	-	X	-	-
9 – 10	X	X	X	-
Маркировка	0	1	2	3

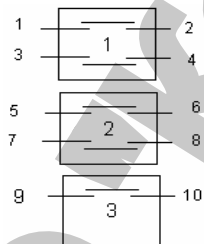


3076 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	-	X	X	-
3 – 4	X	X	-	-
5 – 6	X	X	-	X
7 – 8	X	-	-	-
9 – 10	X	X	X	-
Маркировка	4	1	2	3

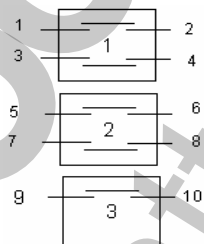


3077 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	X	-	-
3 – 4	-	X	-	-
5 – 6	-	X	-	X
7 – 8	-	-	X	-
9 – 10	-	-	-	X
Маркировка	0	3	1	2

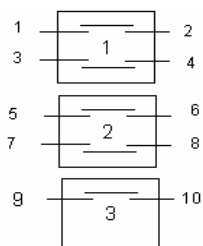


3078 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	X	-	X
3 – 4	X	X	-	X
5 – 6	X	-	X	X
7 – 8	X	-	X	X
9 – 10	-	-	X	X
Маркировка	4	1	2	3

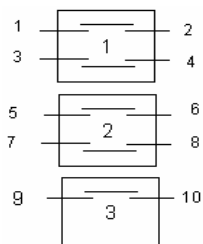


3079 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	-	X	-
3 – 4	-	-	-	X
5 – 6	-	X	-	X
7 – 8	-	-	-	X
9 – 10	-	X	-	-
Маркировка	0	3	1	2

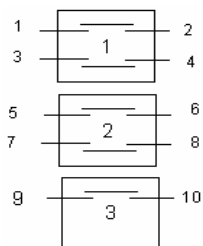


3080 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
Маркировка	4	1	2	3

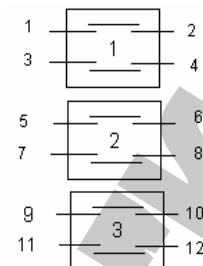


3082 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 - 2	X	-
3 - 4	-	X
5 - 6	-	X
7 - 8	-	X
9 - 10	-	X
11 - 12	-	X
Маркировка	1	2

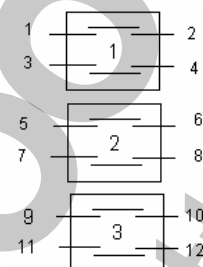


3083 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 - 2	X	-
3 - 4	X	-
5 - 6	-	X
7 - 8	-	X
9 - 10	-	X
11 - 12	-	X
Маркировка	1	2

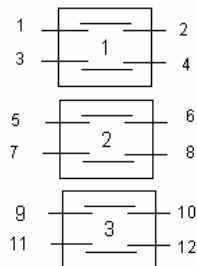


3085 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	X
3 – 4	-	X	X	-
5 – 6	X	-	X	-
7 – 8	-	X	X	-
9 – 10	-	-	X	X
11 – 12	-	X	-	X
Маркировка	3	4	1	2

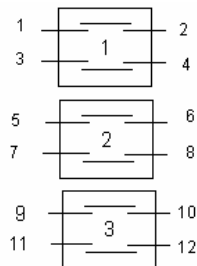


3086 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X	-
3 – 4	X	-	-	X
5 – 6	-	X	-	X
7 – 8	-	X	X	-
9 – 10	X	-	-	X
11 – 12	-	X	-	X
Маркировка	3	4	1	2

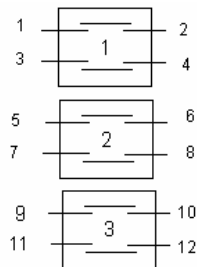


3087 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X	-
3 – 4	X	-	X	-
5 – 6	-	-	X	X
7 – 8	-	X	-	X
9 – 10	X	-	-	-
11 – 12	-	-	X	-
Маркировка	3	4	1	2

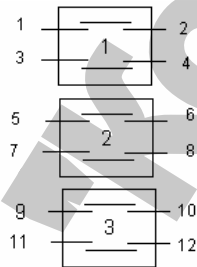


3088 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-
3 – 4	X	-	X	X
5 – 6	X	X	-	X
7 – 8	-	X	-	-
9 – 10	-	-	-	X
11 – 12	-	-	-	X
Маркировка	4	1	2	3

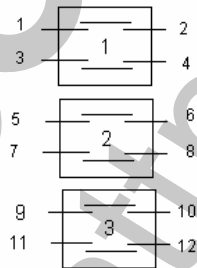


3089 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	X	X	-	X
5 – 6	X	-	X	X
7 – 8	-	-	X	-
9 – 10	X	-	-	-
11 – 12	-	X	-	-
Маркировка	4	1	2	3

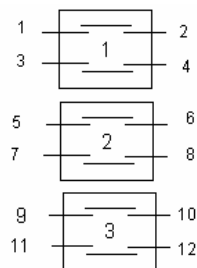


3090 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 - 2	-	X
3 - 4	X	-
5 - 6	X	-
7 - 8	-	X
9 - 10	X	-
11 - 12	-	X
Маркировка	1	2

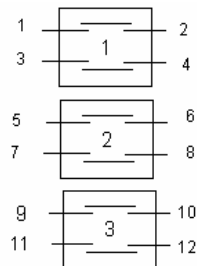


3091 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	X	-	-
9 - 10	-	X	-
11 - 12	-	-	X
Маркировка	3	1	2

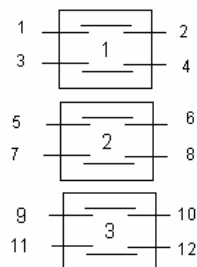


3093 Соединяемые контакты	Способ фиксации: Л, (Е)				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	-	-	-	X	X
3 - 4	X	X	-	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	X	-	-
9 - 10	X	-	-	-	X
11 - 12	X	X	-	X	X
Маркировка	4	5 (-)	1	2 (-)	3

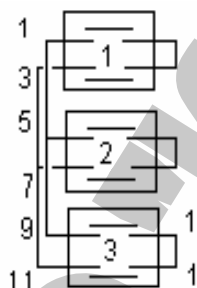


3097 Соединяемые контакты	Способ фиксации: Д			
	Положение рукоятки			
	-90°	0°	+90°	+180°
1 - 2	X	X	-	-
3 - 4	-	-	X	X
5 - 6	X	-	X	-
7 - 8	-	X	-	X
9 - 10	X	-	-	X
11 - 12	-	X	X	-
Маркировка	4	1	2	3

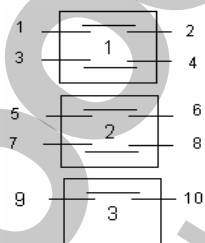


3098 Соединяемые контакты	Способ фиксации: Н (без ограничения хода рукоятки)							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	-	-	-	-	-	X	-	X
3 - 4	-	X	-	X	-	-	-	-
5 - 6	-	X	-	X	-	-	-	-
7 - 8	-	X	-	-	-	-	-	X
9 - 10	-	-	-	X	-	X	-	-
Маркировка	0	1	0	2	0	3	0	4

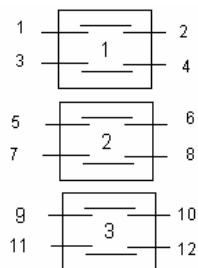


3099 Соединяемые контакты	Способ фиксации: Н (без ограничения хода рукоятки)							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	-	-	-	-	X	-	X
3 - 4	-	-	-	-	-	X	-	-
5 - 6	-	X	-	-	-	-	-	-
7 - 8	-	X	-	-	-	-	-	X
9 - 10	-	-	-	X	-	-	-	-
11 - 12	-	-	-	X	-	-	-	-
Маркировка	0	1	0	2	0	3	0	4

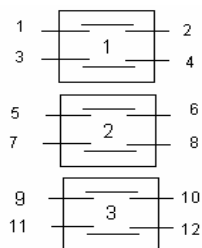


3100 Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	-	X	-	-	-	-
3 - 4	-	X	-	-	-	-
5 - 6	-	-	-	X	-	-
7 - 8	-	-	-	X	-	-
9 - 10	-	-	-	-	-	X
11 - 12	-	-	-	-	-	X
Маркировка	0	3	0	1	0	2

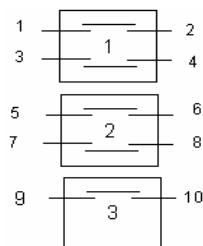


3102* Соединяемые контакты	Без рукоятки, без фиксации положений коммутации	
	-90 ⁰	0 ⁰
1 - 2	-	X
3 - 4	X	-
5 - 6	-	X
7 - 8	X	-
9 - 10	-	X
* применяется в приводе высоковольтного электромагнитного выключателя		

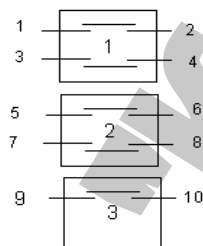


3103 Соединяемые контакты	Способ фиксации: К				
	Положение рукоятки				
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	X	X	X
5 - 6	-	-	-	-	X
7 - 8	X	-	-	-	-
9 - 10	-	-	-	X	X
Маркировка	4	0	1	2	3

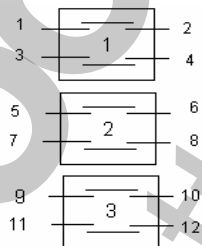


3104 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	X
3 - 4	X	-	-	-
5 - 6	X	-	-	X
7 - 8	-	-	X	-
9 - 10	-	X	-	-
11 - 12	-	X	-	-
Маркировка	4	1	2	3

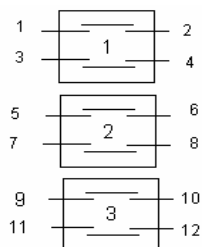


3105 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	-	-	-	X	-
7 - 8	-	-	-	X	X
9 - 10	-	-	-	-	X
11 - 12	X	-	-	-	-
Маркировка	3	0	0	1	2

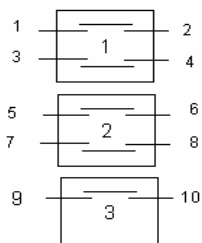


3106 Соединяемые контакты	Способ фиксации: К				
	Положение рукоятки				
	-45°	0°	+45°	+90°	+135°
1 - 2	-	-	X	-	X
3 - 4	-	-	-	X	X
5 - 6	-	X	X	X	X
7 - 8	-	X	X	X	X
9 - 10	-	X	X	X	X
Маркировка	0	1	2	3	4

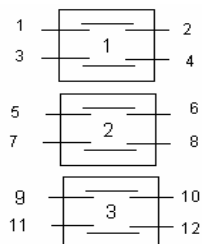


3107 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 - 2	-	X	-	-
3 - 4	-	-	-	X
5 - 6	-	X	-	-
7 - 8	-	-	-	X
9 - 10	-	-	X	X
11 - 12	-	-	X	X
Маркировка	1	2	3	4

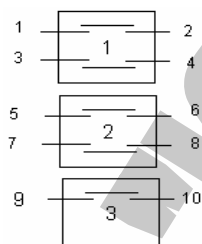


3108 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 - 2	X	-	-	-
3 - 4	X	-	-	-
5 - 6	X	-	-	-
7 - 8	-	X	-	-
9 - 10	-	-	-	X
Маркировка	2	3	0	1

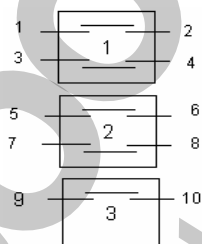


3109 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	X	-	X	X
3 - 4	-	-	-	X	X
5 - 6	-	-	-	-	X
7 - 8	-	X	-	-	-
9 - 10	X	-	-	-	-
Маркировка	4	3	0	1	2

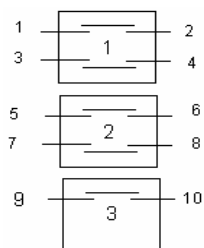


3110 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	-	-	-
3 - 4	X	-	X	-	-
5 - 6	X	-	-	X	-
7 - 8	X	-	-	-	X
9 - 10	-	X	X	X	X
Маркировка	1	2	3	4	5

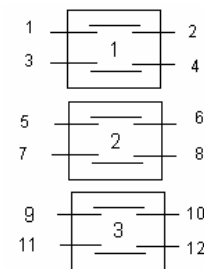


3111 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	X	-	-	-	-	-	-
3 - 4	X	-	-	-	-	-	-	-
5 - 6	X	X	-	X	X	X	X	X
7 - 8	-	-	-	-	X	X	-	-
9 - 10	-	-	-	-	-	-	X	X
11 - 12	-	-	-	-	-	X	-	X
Маркировка	7	8	1	2	3	4	5	6

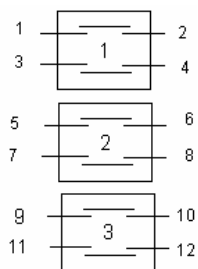


3112 Соединяемые контакты	Способ фиксации: С, (Ж)		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	X	-	-
5 - 6	-	-	X
7 - 8	X	-	-
9 - 10	-	-	X
11 - 12	X	-	-
Маркировка	2	0 (-)	1

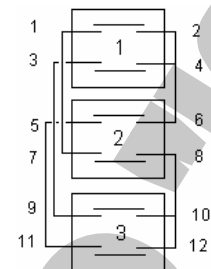


3113 Соединяемые контакты	Способ фиксации: Д			
	Положение рукоятки			
	-90 ⁰	0 ⁰	+90 ⁰	+180 ⁰
1 - 2	X	X	-	-
3 - 4	X	-	X	-
5 - 6	X	-	-	X
7 - 8	-	-	X	X
9 - 10	-	X	-	X
11 - 12	-	X	X	-
Маркировка	4	1	2	3

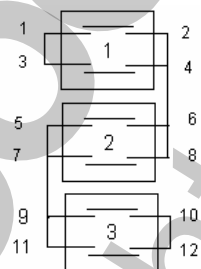


3114 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	-	X
3 - 4	-	-	-	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 - 10	-	X	X	X
11 - 12	-	X	X	X
Маркировка	0	1	2	3

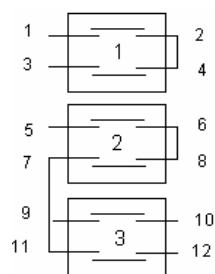


3117 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	X	X
5 - 6	X	X	-	-	-
7 - 8	-	-	-	-	X
9 - 10	-	X	-	X	-
11 - 12	-	-	X	-	-
Маркировка	1	2	3	4	5

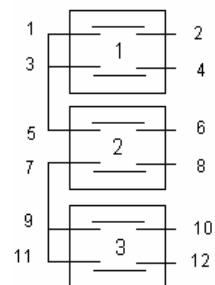


3118 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-
3 - 4	-	-	X	-
5 - 6	-	-	-	X
7 - 8	X	-	-	-
9 - 10	-	-	X	-
11 - 12	-	-	-	X
Маркировка	4	1	2	3

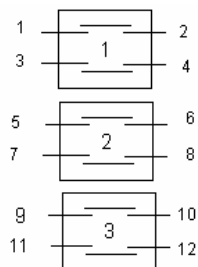


3119 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	X	X	-	X	-	-
3 - 4	-	X	-	-	-	-	-
5 - 6	X	-	-	-	-	-	-
7 - 8	-	-	-	-	-	-	X
9 - 10	-	-	-	-	-	X	-
11 - 12	-	-	-	-	-	X	X
Маркировка	6	5	4	0	1	2	3

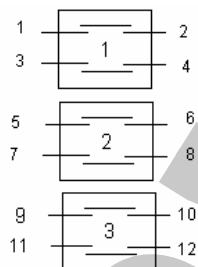


3120 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	-	X	X	X	X	X	X
3 - 4	-	X	-	X	X	X	X
5 - 6	-	-	-	-	-	X	X
7 - 8	-	-	X	-	X	-	-
9 - 10	-	X	-	-	-	-	X
11 - 12	-	-	X	X	X	X	X
Маркировка	0	1	2	3	4	5	6

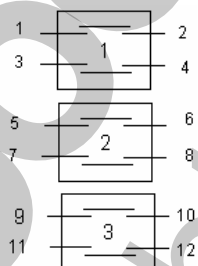


3121 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	-	X	X
7 - 8	X	-	-
9 - 10	-	X	-
11 - 12	-	-	X
Маркировка	3	1	2

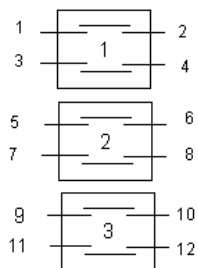


3122 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	-	-	X	-
5 – 6	-	-	-	X
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	-	-	X
Маркировка	0	1	2	3

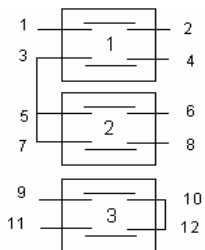


3123 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-	-
3 – 4	X	X	-	X	X
5 – 6	-	-	-	-	X
7 – 8	X	-	-	-	-
9 – 10	-	-	-	X	X
11 – 12	X	X	-	-	-
Маркировка	4	5	1	2	3

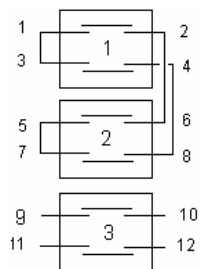


3124 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	X
11 – 12	X	-	X
Маркировка	2	0	1

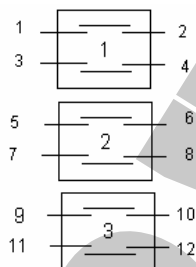


3125 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	X	-	-	-
3 – 4	X	X	X	-	X	X	X
5 – 6	X	X	-	-	-	-	-
7 – 8	-	-	-	-	-	X	X
9 – 10	X	-	-	-	-	-	X
11 – 12	-	-	-	X	-	-	-
Маркировка	5	6	7	1	2	3	4

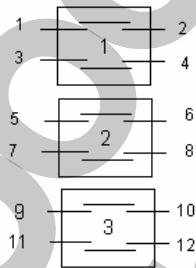


3126 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-	-
3 – 4	-	-	-	X	X
5 – 6	X	X	-	-	-
7 – 8	-	-	-	-	X
9 – 10	-	X	-	X	-
11 – 12	-	-	X	-	-
Маркировка	4	5	1	2	3

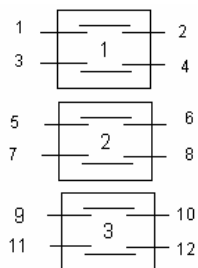


3127 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	-	X	-	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	-	-	X
Маркировка	0	1	0	2

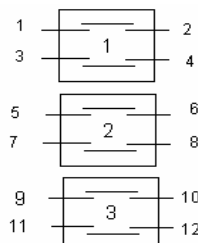


3128 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	X	-	X
3 - 4	X	X	X	-	X
5 – 6	-	-	-	-	X
7 – 8	-	-	-	-	X
9 – 10	X	X	-	-	-
11 - 12	X	-	-	-	-
Маркировка	1	2	3	0	4

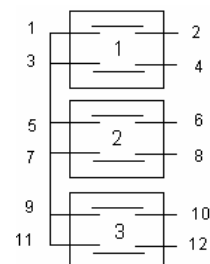


3129 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	X	-	-	-	-	-
3 – 4	-	X	-	-	-	-
5 – 6	-	-	X	-	-	-
7 – 8	-	-	-	X	-	-
9 - 10	-	-	-	-	X	-
11 - 12	-	-	-	-	-	X
Маркировка	5	6	1	2	3	4

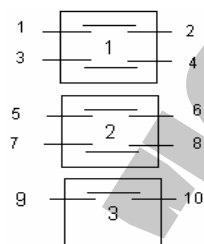


3130 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	X	-	-	-
Маркировка	1	2	3	4

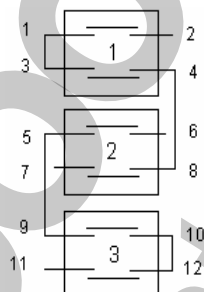


3131 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	X	-	-	-	-	-
3 – 4	-	X	-	-	-	-
5 – 6	-	-	-	X	-	-
7 – 8	-	-	X	-	-	-
9 - 10	-	-	-	-	X	-
11 - 12	-	-	-	-	-	X
Маркировка	5	6	1	2	3	4

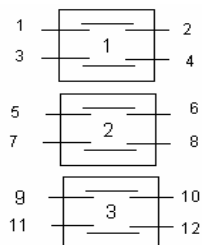


3132 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	X	X	X
3 – 4	-	-	X	-
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	-	-	X
Маркировка	0	1	2	3

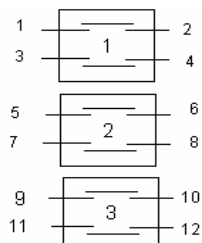


3133 Соединяемые контакты	Способ фиксации: АП		
	Положение рукоятки		
	-45°	0° ←	+45°
1 – 2	-	X	X
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	X	-	-

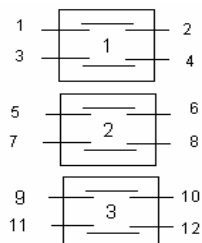


3134 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	-	X	X
3 – 4	-	-	X	X
5 – 6	-	X	-	-
7 – 8	-	-	X	-
9 – 10	-	X	-	-
11 – 12	-	-	X	-
Маркировка	0	1	2	3

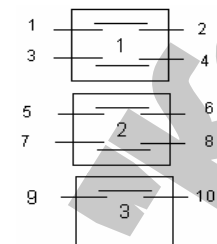


3135 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 – 2	-	X
3 – 4	X	-
5 – 6	-	X
7 – 8	X	-
9 – 10	-	X
Маркировка	1	2

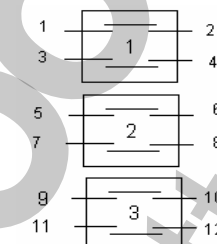


3136 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	X	-	-	-
11 – 12	-	-	X	-
Маркировка	1	0	2	3

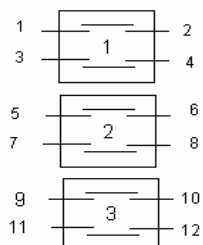


3137 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-	-
3 – 4	X	X	-	X	-
5 – 6	-	-	-	-	X
7 – 8	X	X	-	-	-
9 – 10	X	-	-	-	-
11 – 12	-	-	X	-	-
Маркировка	4	5	1	2	3

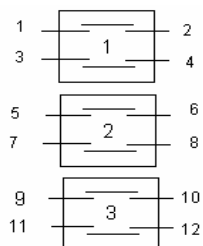


3138 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-	-
3 – 4	-	X	-	-	-
5 – 6	-	X	-	-	-
7 – 8	-	-	-	X	-
9 – 10	-	-	-	X	-
11 – 12	-	-	-	-	X
Маркировка	3	4	0	1	2

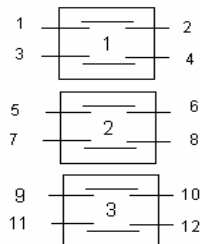


3139 Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
Маркировка	2	0	1

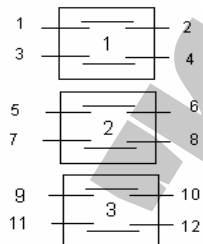


3140 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	X	X	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	X	-	-
Маркировка	3	1	2

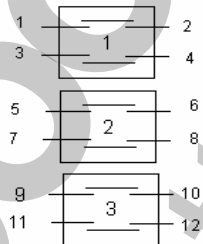


3141 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
Маркировка	0	1	2

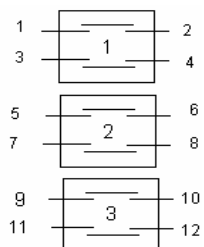


3142 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	X	-
11 – 12	X	X	-
Маркировка	3	1	2

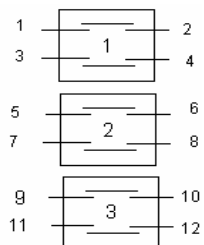


3143 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	-
3 – 4	-	X	X
5 – 6	X	X	-
7 – 8	-	X	X
9 – 10	X	X	-
11 – 12	-	X	X
Маркировка	3	1	2

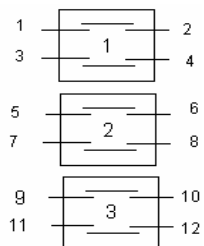


3144 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	-	X	-	-	-	-
3 – 4	-	-	X	-	-	-
5 – 6	-	-	-	X	-	-
7 – 8	-	-	-	-	X	X
9 – 10	-	-	-	-	-	X
11 – 12	-	X	X	X	X	-
Маркировка	5	6	1	2	3	4

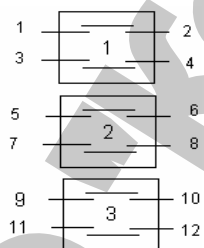


3145 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	X	-	-	-
3 – 4	X	-	X	X	-
5 – 6	X	X	X	-	-
7 – 8	-	-	X	X	X
9 – 10	-	X	-	-	X
11 – 12	-	-	-	X	X
Маркировка	4	5	1	2	3

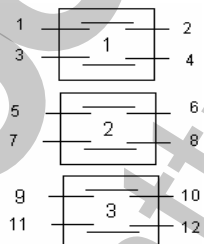


3146 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	-	X	-	-
7 – 8	-	X	-	-
9 – 10	-	-	-	X
11 – 12	-	-	-	X
Маркировка	2	3	0	1

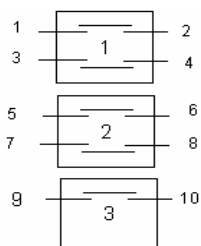


3147 Соединяемые контакты	Способ фиксации: К				
	Положение рукоятки				
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	-	X	-
9 - 10	-	-	-	-	X
Маркировка	5	1	2	3	4

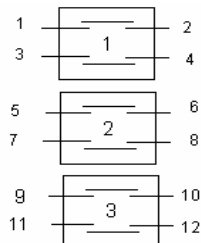


3148 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	X	-
3 - 4	-	-	X
5 - 6	-	X	-
7 - 8	-	X	X
9 - 10	-	-	X
11 - 12	-	X	-
Маркировка	3	1	2

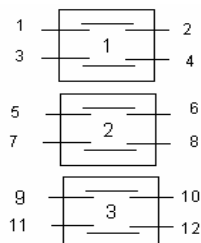


3149 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	X	-	-
5 - 6	-	X	-
7 - 8	-	X	-
9 - 10	-	-	X
11 - 12	-	-	X
Маркировка	1	2	3

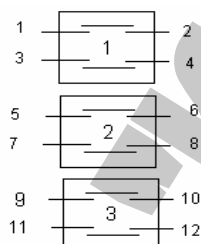


3150 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	-
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	X	X	X
9 - 10	-	X	X	X
11 - 12	-	X	X	X
Маркировка	0	1	2	3

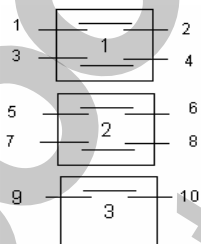


3151 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	X	-	X
5 - 6	X	-	X
7 - 8	X	-	-
9 - 10	-	-	X
Маркировка	2	0	1

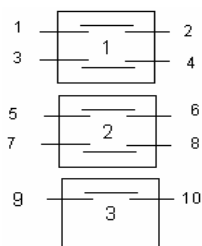


3152 Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 – 2	X	-	X
3 – 4	X	-	X
5 – 6	X	-	X
7 – 8	X	-	-
9 – 10	-	-	X
Маркировка	3	1	2

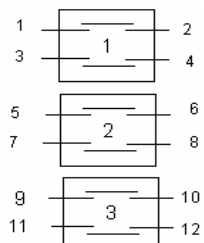


3153 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	X	-
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	X	-
11 – 12	X	-	-
Маркировка	3	1	2

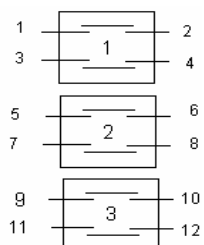


3154 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	X	-	-	-	-	-
3 – 4	-	X	-	-	-	-
5 – 6	-	-	X	-	-	-
7 – 8	-	-	-	X	-	-
9 – 10	-	-	-	-	X	-
11 – 12	-	-	-	-	-	X
Маркировка	5	6	1	2	3	4

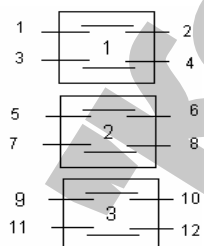


3155 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-	-
3 – 4	-	-	-	-	X
5 – 6	-	-	-	X	X
7 – 8	-	X	-	X	-
9 – 10	X	-	-	-	-
11 – 12	X	-	-	-	-
Маркировка	3	4	0	1	2

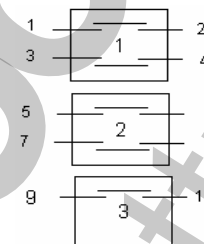


3156 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-
3 – 4	-	-	-	X
5 – 6	-	X	X	X
7 – 8	X	-	-	-
9 – 10	-	X	X	X
Маркировка	4	1	2	3

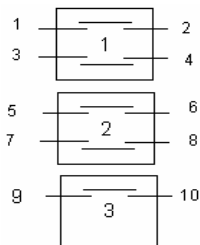


3157 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0^0	$+45^0$
1 - 2	-	X
3 - 4	-	X
5 - 6	X	-
7 - 8	X	-
9 - 10	X	-
Маркировка	1	2

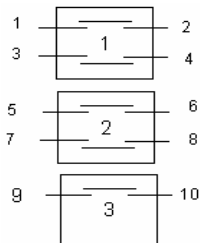


3158 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 - 2	X	-	-
3 - 4	X	-	-
5 - 6	-	X	-
7 - 8	-	X	-
9 - 10	-	-	X
Маркировка	3	1	2

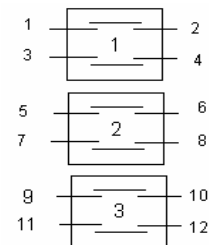


3159 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45^0	0^0	$+45^0$	$+90^0$
1 - 2	X	-	-	-
3 - 4	X	X	X	-
5 - 6	-	X	X	-
7 - 8	-	-	X	-
9 - 10	-	-	-	X
11 - 12	-	-	-	X
Маркировка	4	1	2	3

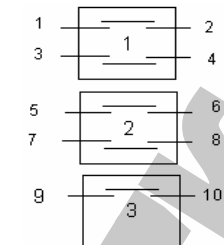


3160 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45^0	0^0	$+45^0$	$+90^0$
1 - 2	-	-	-	X
3 - 4	-	-	X	X
5 - 6	-	-	-	X
7 - 8	-	-	X	X
9 - 10	X	-	-	-
Маркировка	4	1	2	3

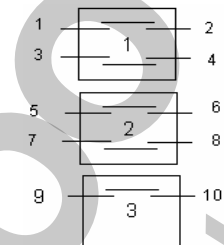


3161 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 - 2	-	-	X	-
3 - 4	-	-	-	X
5 - 6	X	-	-	-
7 - 8	-	-	-	X
9 - 10	-	X	X	-
Маркировка	3	4	1	2

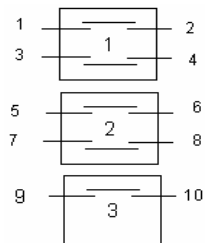


3162 Соединяемые контакты	Способ фиксации: К				
	Положение рукоятки				
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	-	-	-	X
7 - 8	-	-	X	-	-
9 - 10	-	-	-	X	X
Маркировка	0	1	2	3	4

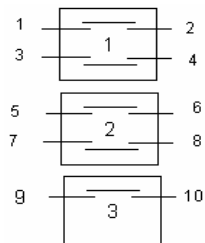


3163 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	X	-	-
5 - 6	X	-	-
7 - 8	-	X	-
9 - 10	-	-	X
Маркировка	3	1	2

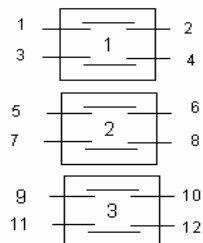


3164 Соединяемые контакты	Способ фиксации: К				
	Положение рукоятки				
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	-	X	-
9 - 10	-	-	-	-	X
11 - 12	-	X	X	X	X
Маркировка	5	1	2	3	4

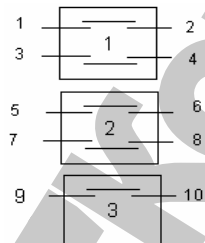


3165 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	-	X
3 - 4	-	X
5 - 6	X	-
7 - 8	X	-
9 - 10	-	X
Маркировка	1	2

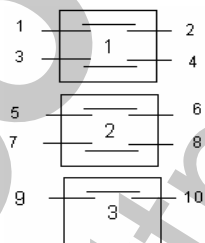


3166 Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	X	X	-
3 - 4	X	X	-	X
5 - 6	-	-	-	X
7 - 8	X	X	X	-
9 - 10	X	-	X	X
Маркировка	1	2	3	4

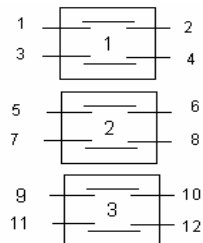


3167 Соединяемые контакты	Способ фиксации: АЛ		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	X	-
11 – 12	-	-	X

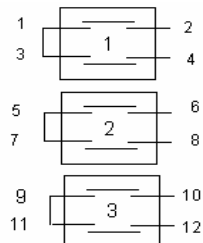


3168 Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0°	+45°	+90°	+135°
1 – 2	X	-	-	-
3 – 4	-	X	X	X
5 – 6	X	X	-	-
7 – 8	-	-	X	X
9 – 10	X	X	X	-
11 – 12	-	-	-	X
Маркировка	1	2	3	4

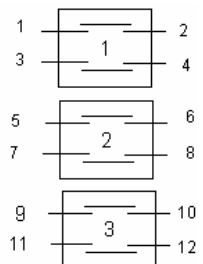


3169 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 – 2	-	X	-	-	-	-	-	-
3 – 4	-	-	X	-	-	-	-	-
5 – 6	-	-	-	X	-	-	-	-
7 – 8	-	-	-	-	X	-	-	-
9 – 10	-	-	-	-	-	X	-	-
11 – 12	-	-	-	-	-	-	X	-
Маркировка	6	7	8	1	2	3	4	5

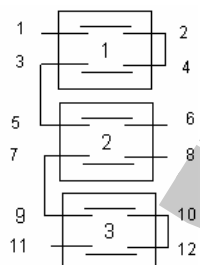


3170 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	-	X
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
Маркировка	2	0	1

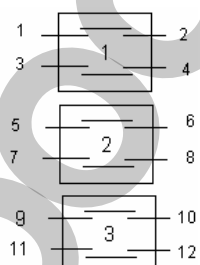


3171 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	-	-	-
3 – 4	X	-	X	-
5 – 6	-	-	-	X
7 – 8	-	-	-	X
9 – 10	X	-	X	X
11 – 12	X	-	X	-
Маркировка	3	0	1	2

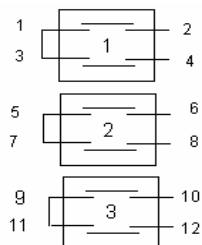


3172 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 - 2	X	-
3 - 4	-	X
5 - 6	X	-
7 - 8	-	X
9 - 10	X	-
11 - 12	-	X
Маркировка	1	2

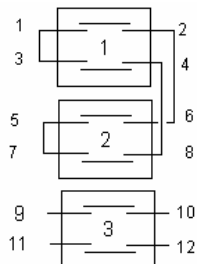


3173 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	X	-	-
9 - 10	X	-	X
11 - 12	-	X	-
Маркировка	2	0	1

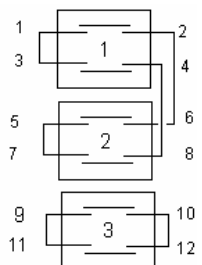


3174 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	X
11 - 12	X	-	X
Маркировка	2	0	1

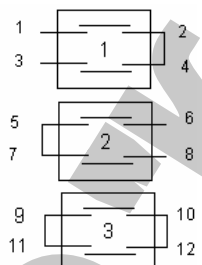


3175 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	-	X
3 - 4	X	-	-
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	X
11 - 12	X	-	X
Маркировка	2	0	1

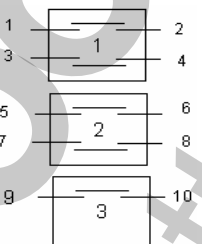


3176 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 - 2	-	-	X	X
3 - 4	-	-	X	-
5 - 6	-	-	X	X
7 - 8	-	X	X	X
9 - 10	-	-	X	X
Маркировка	0	1	2	3

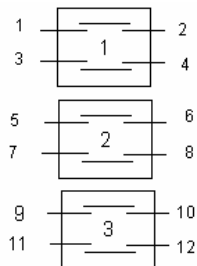


3177 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	-	X	-	X
5 – 6	X	-	X	-
7 – 8	-	X	-	X
9 – 10	X	-	X	-
11 – 12	X	-	X	-
Маркировка	1	2	3	4

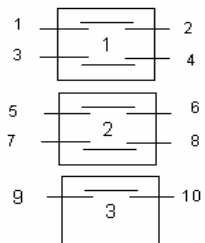


3178 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-	-
3 – 4	-	-	X	-	-
5 – 6	-	-	-	X	X
7 – 8	-	X	-	-	-
9 – 10	-	-	-	-	X
Маркировка	0	1	2	3	4

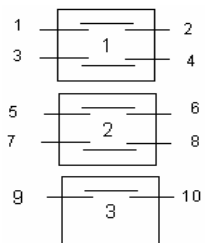


3179 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	X
3 – 4	X	-	-	-
5 – 6	-	-	-	X
7 – 8	X	-	-	-
9 – 10	X	-	-	-
Маркировка	1	2	3	4

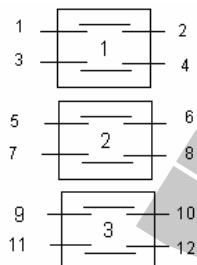


3180 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	-	X	X	X
5 – 6	-	-	X	X
7 – 8	-	-	X	-
9 – 10	-	-	X	X
11 – 12	-	-	X	X
Маркировка	0	1	2	3

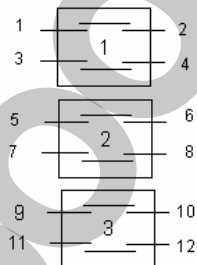


3181 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	-
3 – 4	X	-	X
5 – 6	-	X	X
7 – 8	-	-	X
9 – 10	-	X	-
11 – 12	X	-	-
Маркировка	3	1	2

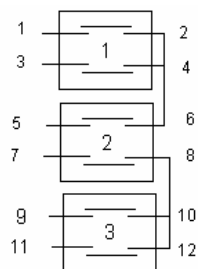


3182 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	X	-
9 – 10	-	-	X
11 – 12	X	-	-
Маркировка	1	2	3

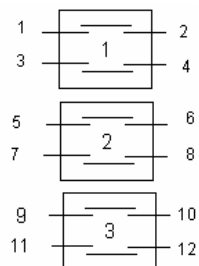


3183 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	X	-
3 – 4	X	X	-	-
5 – 6	X	-	-	-
7 – 8	-	-	-	X
9 – 10	-	-	X	X
11 – 12	-	X	X	X
Маркировка	4	3	1	2

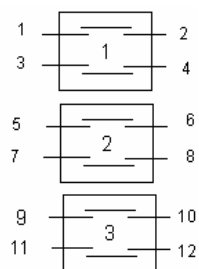


3184 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	X	X	X	-	-	-
3 – 4	-	X	-	-	-	-	-
5 – 6	-	-	X	-	X	-	-
7 – 8	-	-	-	X	-	X	X
9 – 10	-	-	-	-	X	-	X
11 – 12	-	-	-	-	-	X	-
Маркировка	0	5	6	1	2	3	4

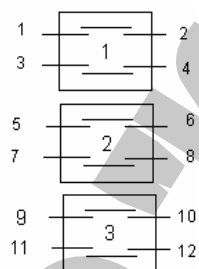


3185 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	X	-	-
Маркировка	2	0	1

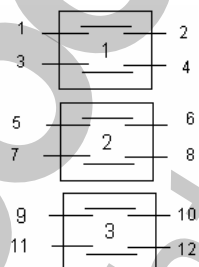


3186 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	-	-	-	X
3 – 4	X	X	-	-	-	-	-
5 – 6	-	X	-	-	-	X	-
7 – 8	-	-	X	-	-	-	-
9 – 10	X	-	X	-	X	-	-
11 – 12	-	-	-	-	X	X	X
Маркировка	6	5	4	0	1	2	3

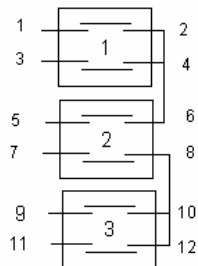


3187 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	X	-
11 - 12	-	-	X
Маркировка	1	2	3

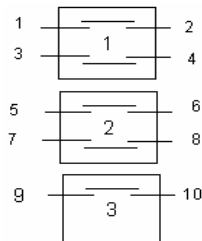


3188 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 - 2	-	X	X	X
3 - 4	-	X	-	-
5 – 6	-	X	-	X
7 – 8	-	X	X	X
9 – 10	-	X	-	-
Маркировка	0	1	2	3

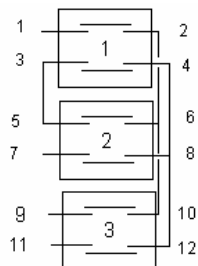


3189 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	-	-	-	-	-	X	-	X
3 - 4	-	-	-	-	-	X	-	-
5 – 6	-	X	-	-	-	-	-	-
7 - 8	-	X	-	-	-	-	-	X
9 – 10	-	-	-	X	-	-	-	-
11 - 12	-	-	-	X	-	-	-	-
Маркировка	0	1	0	2	0	3	0	4

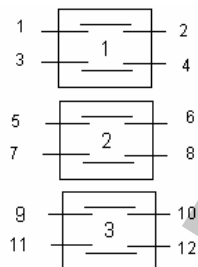


3190 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90°	-45°	0°	+45°	+90°	+135°
1 – 2	-	X	-	-	-	-
3 – 4	-	-	X	-	-	-
5 – 6	-	-	-	X	-	-
7 – 8	-	-	-	-	X	-
9 - 10	-	-	-	-	-	X
11 - 12	-	X	-	-	-	-
Маркировка	0	1	2	3	4	5

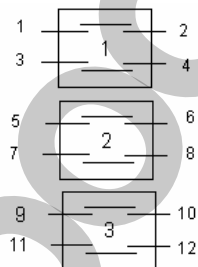


3191 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	X	-
9 – 10	-	-	-	X
11 - 12	-	-	-	X
Маркировка	1	2	3	4

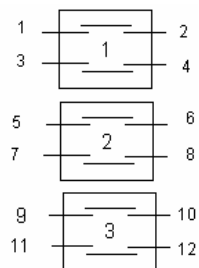


3192 Соединяемые контакты	Способ фиксации: Е			
	Положение рукоятки			
	-90 ⁰		0 ⁰	+90 ⁰
1 - 2	X	-	-	-
3 - 4	-	-	-	X
5 - 6	-	-	-	X
7 - 8	-	-	-	X
9 - 10	-	-	-	X
11 - 12	X	-	-	-
Маркировка	3		1	2

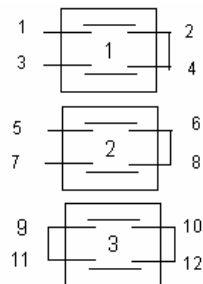


3193 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	-	X
Маркировка	2	0	1

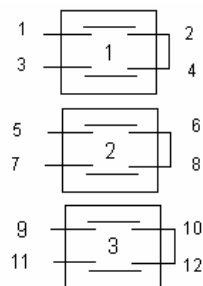


3194 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	-	X
Маркировка	2	0	1

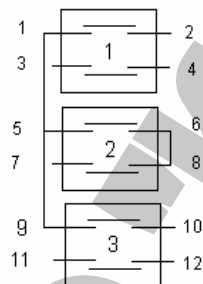


3195 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	X	-	-
5 - 6	-	X	-
7 - 8	-	X	-
9 - 10	-	-	X
11 - 12	-	-	X
Маркировка	2	0	1

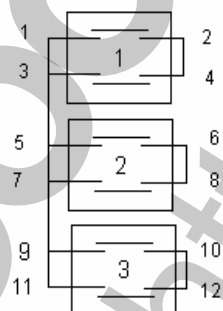


3196 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	X	X
3 - 4	-	X	X	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 - 10	-	-	-	X
11 - 12	-	-	-	X
Маркировка	0	1	2	3

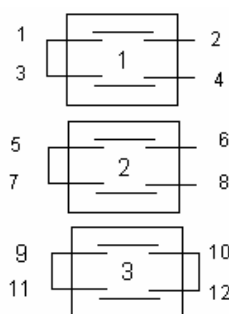


3197 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
Маркировка	2	0	1

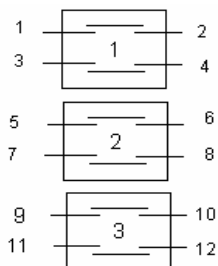


3198 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	X	-	-	-	-
7 - 8	-	-	-	-	X
9 - 10	-	X	-	-	-
11 - 12	-	-	-	X	-
Маркировка	3	4	0	1	2

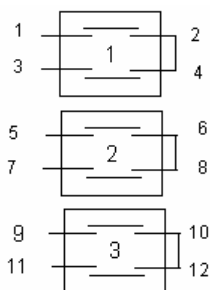

3199 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	-	-	X
11 – 12	-	-	X
Маркировка	1	2	3

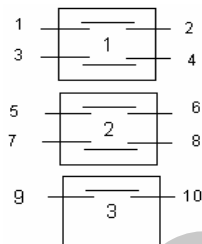

3200 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	X	-	X	X	-	-	X	-
3 - 4	X	X	-	X	-	X	-	-
5 - 6	X	X	X	-	X	-	-	-
7 - 8	-	X	X	X	X	X	X	X
9 - 10	-	X	X	X	X	X	X	X
Маркировка	8	7	6	5	4	3	2	1

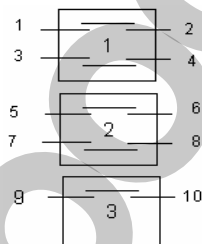

3201 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	-	X	-	-
5 - 6	-	-	-	X	-
7 - 8	-	-	-	-	X
9 - 10	-	X	X	X	X
Маркировка	0	1	2	3	4